ASSEMBLY AND INSTALLATION INSTRUCTIONS

WARNING: TO AVOID RISK OF ELECTRICAL SHOCK, BE SURE TO SHUT OFF POWER WHILE INSTALLING OR SERVICING THIS FIXTURE.


NOTES: 1. Before installing, consult local electrical codes for wiring and grounding requirements. 2. READ AND SAVE THIS INSTRUCTION.

Hardware Package (included):		
	(Construction) (Construction)	Ŷ
Mounting Strap (A)	Mounting Screw (B)	Green Ground Screw (C)
66	(f) management (f) management	
Lock Nut (D)	Fixture Mounting Screw (E)	Wire Connector (F)
	$\bigcirc \bigcirc$	
Strain Relief (G)	Ball Nut (H)	Flat Head Screwdriver (I)

Installation Steps

Turn off the power at fuse or circuit box.


- 1. Unscrew two ball nuts (H), remove mounting strap (A) from canopy.
- 2. Loosen the plastic headless screw on the canopy by using flat head screwdriver (I).
- Install a bulb on the socket, attach the socket into the glass shade by inserting the threaded pipe, put the cap through the threaded pipe and adjust position of it to ensure it set in the center of glass, then thread the plastic headless screw onto threaded pipe and fasten by using flat head screwdriver (I).
 Caution :Please be careful for installation since the bulb will be easily damaged if crash the glass shade.
- 4. Thread the cord through the canopy and strain relief (G). Measure the desired length of the cord (a) from the canopy to the glass shade and leave additional 9" cord (b) above the canopy (include the canopy), and then cut off the unnecessary cord. (See Fig.1)
- 5. Adjust strain relief (G) at 9" position from the top of the cord.
- Mark the 3" cord (c) from the top of the cord (b). Use a knife to peel off the insulation of the cord (c) carefully to show the 3 inside wires out. (See Fig. 1)
 Caution : Cutting too deep may cut off three inside wires and destroy the insulation surface of the three inside wires.
- 7. Peel off the 3 wires from the top about 3/8" long (d) to expose the copper for wiring.
- 8. Attach the mounting strap (A) to outlet box by using two mounting screws (B).

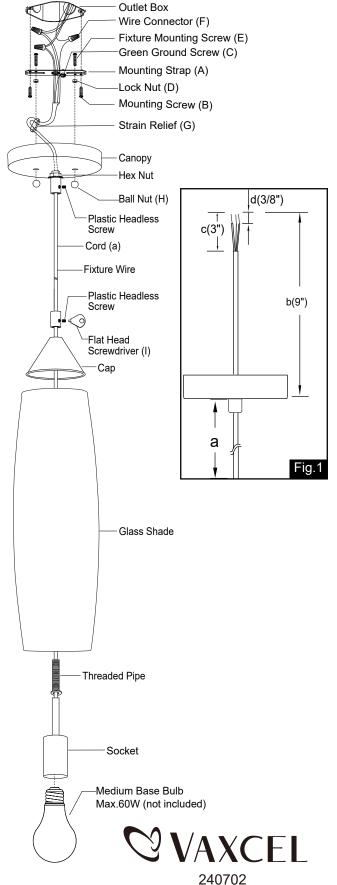

- 9. Pull out the source wires from the outlet box. Make wire connections using wire connectors (F) as follows:
 - a. Connect the black wire marked "L" from the fixture to the black wire from the power source.
 - b. Connect the white wire marked "N" from the fixture to the white wire from the power source.
 - c. Connect the copper wire or green wire marked ", "from the fixture to the mounting strap (A) by securing it with the green ground screw. The green ground wire marked ", "from the fixture to the green ground wire from power source. Carefully put wires back into the outlet box.
- 10. Pull the cord (a) down slightly until the strain relief (G) touches the hex nut. Attach two fixture mounting screws (E) to the mounting strap (A), then secure it with two lock nuts (D). Adjust the length of the fixture mounting screws (E) if necessary, then secure it with two ball nuts (H).
- 11. Fastening cord by screwing plastic headless screw, using flat head screwdriver (I).

Turn on the power at fuse or circuit box.

The following parts are available for re-order if damaged or missing.

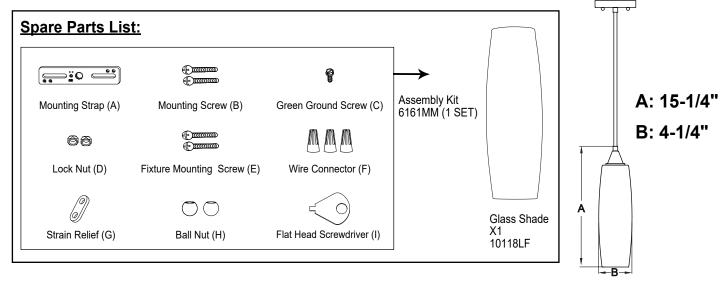

1 Year Warranty

Vaxcel warrants all of our products against defects in workmanship and finishes for one year following the date of shipment.

Exclusions: This warranty does not include the failure of products from extreme acts of nature; environmental conditions not suited for the products intended use; operation in temperatures outside of the range specified in the instruction manual; usage with improper power supply, power surges or dips. For coastal locations, some corrosion is considered normal for the environment.

Vaxcel reserves the right to repair, replace or issue a credit for any properly installed product, provided it is returned per RMA instruction. This warranty is limited to the cost of the product only and does not extend to transportation, installation or replacement costs.

How can warranty service be obtained? info@vaxcel.com 1-800-482-9235

