


ASSEMBLY AND INSTALLATION INSTRUCTIONS

H0230

WARNING: TO AVOID RISK OF ELECTRICAL SHOCK, BE SURE TO SHUT OFF POWER BEFORE INSTALLING OR SERVICING THIS FIXTURE.

NOTES: 1. Before installing, consult local electrical codes for wiring and grounding requirements.
2. Read and save these instructions.

Hardware Package (included):


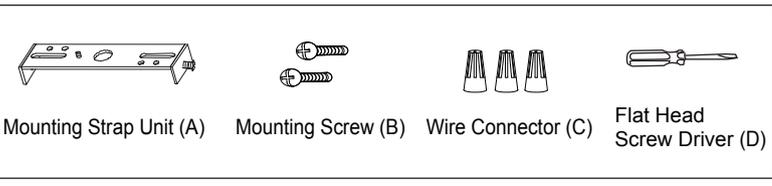


Installation Steps

Turn off the power at fuse or circuit box.

1. Connect mounting strap unit (A) to the outlet box with two mounting screws (B).
2. Adjusting the steel wires and fixture wire length:
 - a. Reduce the steel wires length:
Push the steel wires into the canopy to adjust the steel wires to the desired length.
 - b. Increase the steel wires length:
Press the buttons under the canopy, pull the steel from the canopy to adjust the steel wires to desired length.
Release the buttons to hold the steel wires in position, as shown in the diagram.
 - c. Loosen the plastic screw by using a flat head screwdriver (D) and adjust the fixture wire to the desired length, then tighten the plastic screw back into the hole as shown in the diagram.
3. When you cut the wire for appropriate length, strip 3/4 in. of insulation from wire ends.
Pull out the source wires from the outlet box. Make wire connections using wire connectors as follow:
 - Connect the hot wire (labeled L) from the fixture to the black wire from the power source.
 - Connect the neutral wire (labeled N) from the fixture to the white wire from the power source.
 - Attach the fixture ground wire (labeled \oplus) to the mounting strap unit (A) with the green ground screw, then connect it to the house ground wire with the wire connector (C).
 Carefully put the wires back into the outlet box.
4. Fasten the canopy to the mounting strap unit (A) with 2 side set screws.
5. Hang glasses as shown in the diagram (See Fig.1).
6. Install the G9 base 5 X 40w Max bulbs (not included) .

Turn on the power at fuse or circuit box.

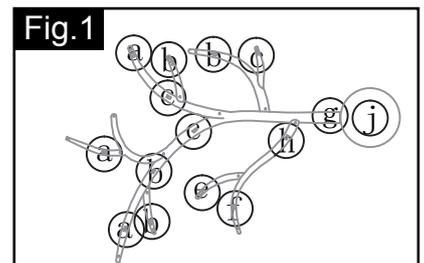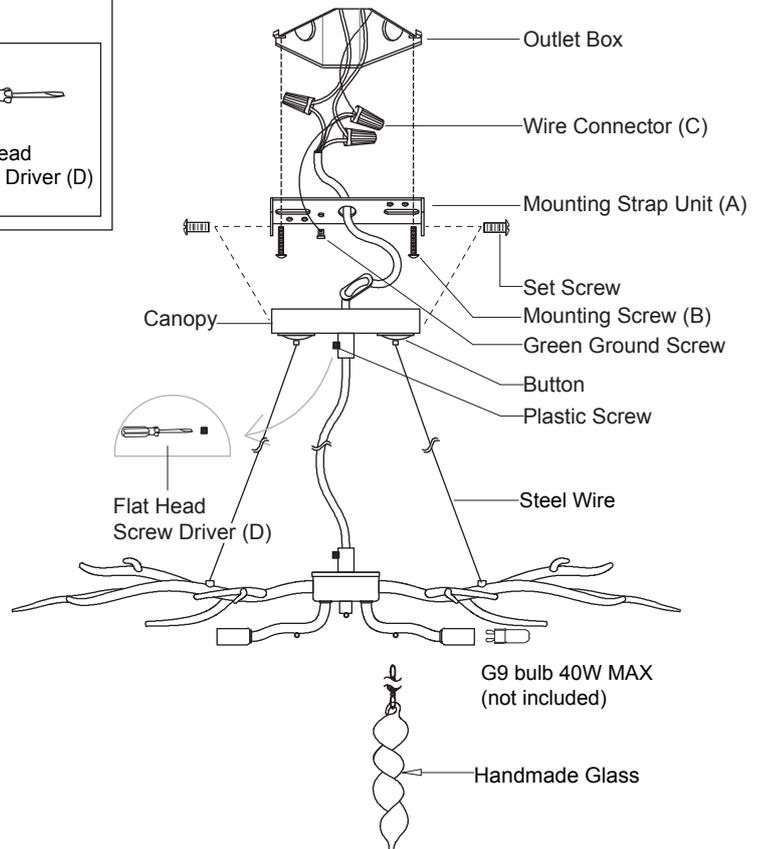


The following parts are available for reorder if damaged or missing.

Spare Parts List:

Mounting Strap Unit (A) Mounting Screw (B) Wire Connector (C) Flat Head Screw Driver (D) Assembly Kit 6095MM (1 SET)

a	b	c	e	f	g	h	j
(15 clusters)	(20 clusters)	(15 clusters)	(5 clusters)	(5 clusters)	(5 clusters)	(5 clusters)	(1 clusters)
5117CD	5118CD	5119CD	5121CD	5122CD	5123CD	5124CD	5126CD

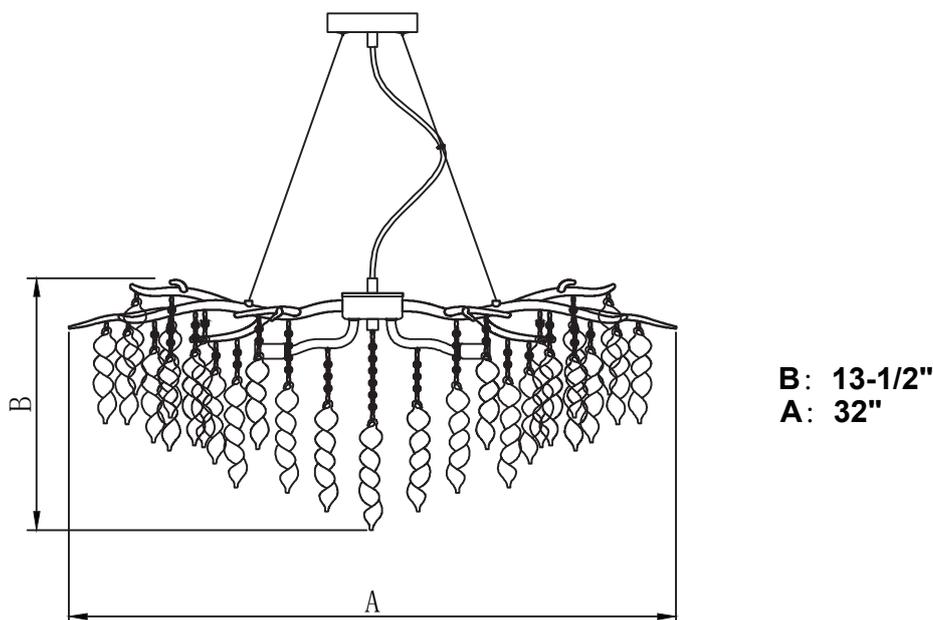

1 Year Warranty

Vaxcel warrants all of our products against defects in workmanship and finishes for one year following the date of shipment.

Exclusions: This warranty does not include the failure of products from extreme acts of nature; environmental conditions not suited for the products intended use; operation in temperatures outside of the range specified in the instruction manual; usage with improper power supply, power surges or dips. For coastal locations, some corrosion is considered normal for the environment.

Vaxcel reserves the right to repair, replace or issue a credit for any properly installed product, provided it is returned per RMA instruction. This warranty is limited to the cost of the product only and does not extend to transportation, installation or replacement costs.

How can warranty service be obtained?

info@vaxcel.com
1-800-482-9235